

TECHNICAL BULLETIN

Ikegami

37 Brook Avenue, Maywood, New Jersey 07607 • (201) 368-9171

Date: 10/30/08
Engineer: Larry Cuccio
Page: 1 of 2

TO: Distribution

Product: HDK-79EC / HDK-79E / HDK-725P / HDK-720P

Symptom: Ret Switch pushbutton function on the handle cover is stuck on


This problem can occur when the handle cover and/or the Ret Button is replaced. The Ret Switch Bracket holds the Ret Button in place. This bracket must be positioned and fastened in the correct orientation, or the stem of the push button will be too far forward and bind against the bracket, causing the Ret function to be activated continuously.

Also, some HDK-79EC covers have handle covers incorrectly assembled at the factory.

Refer to the photographs on the next page for the correct positioning of the bracket. If incorrect, remove the two screws, rotate the bracket 180°, and reattach with the screws.

HDK handle cover Ret Switch push button

Incorrect
stem of rubber push button
too far forward

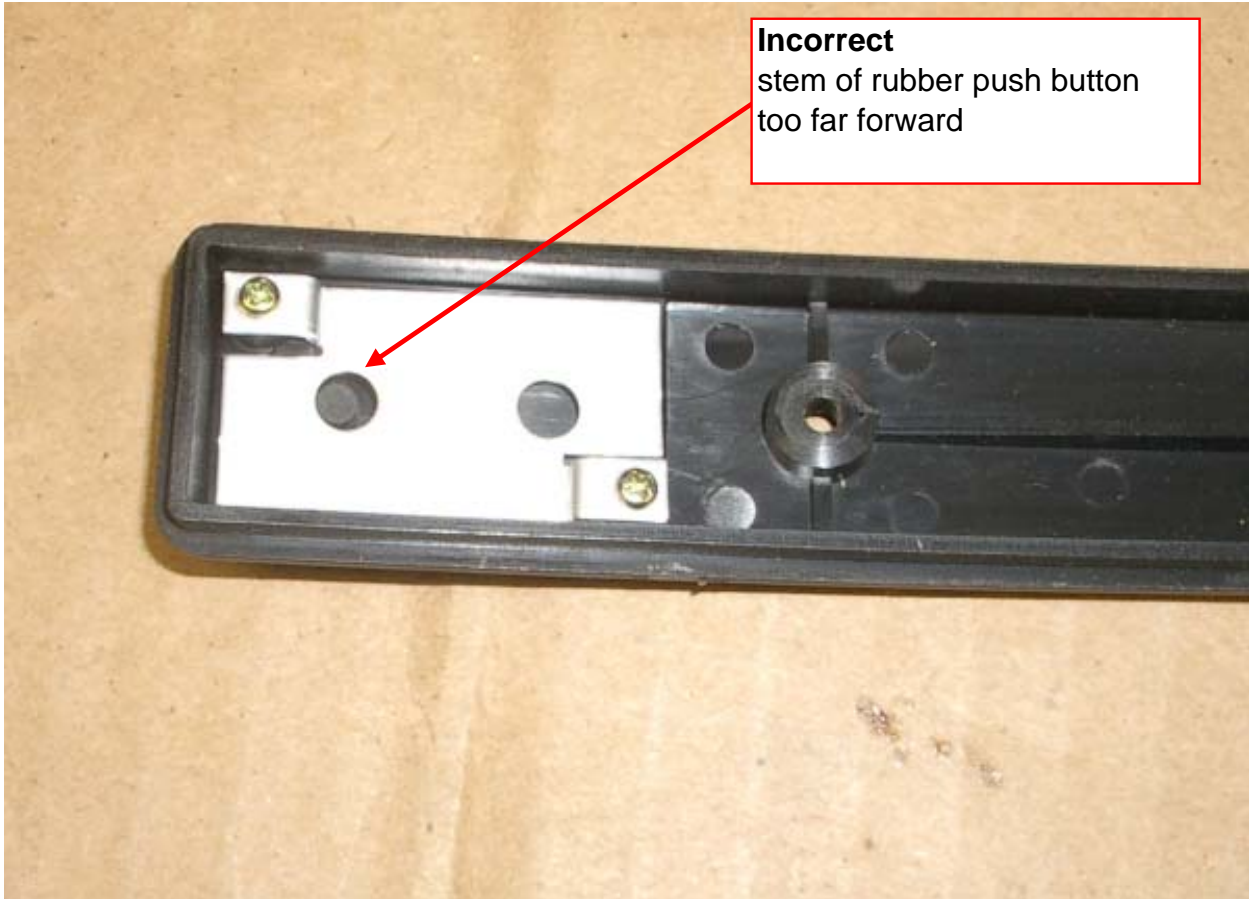

Correct
stem of rubber push button
falls in center of hole

