

TECHNICAL BULLETIN

Ikegami

37 Brook Avenue, Maywood, New Jersey 07607 • (201) 368-9171

Ref No: 3006

Date: July 25, 1991

Eng: John Lynch

Page: 1 of 1

To: All Regional Offices and Field Service Engineers

Product: 15 Series and 19 Series Monitors
TM14-15RH, TM20-15RH, TM14-19RH and TM20-19RH

Symptom: Retrace lines at top of monitor.

Cause: On the Deflection Board, a capacitor dries up due to heat and can change in value so that the monitor's vertical deflection circuit changes and shows 2 retrace lines in video at the top of the monitor.

Solution: On the DEF Board change C202
From: ECEA1HU220B 22uF @ 50V
To: ECA1JFQ220 22uF @ 63V

Sincerely,

IKEGAMI ELECTRONICS (USA), INC.



John Lynch

Asst. Director of Engineering

cc: Distribution